


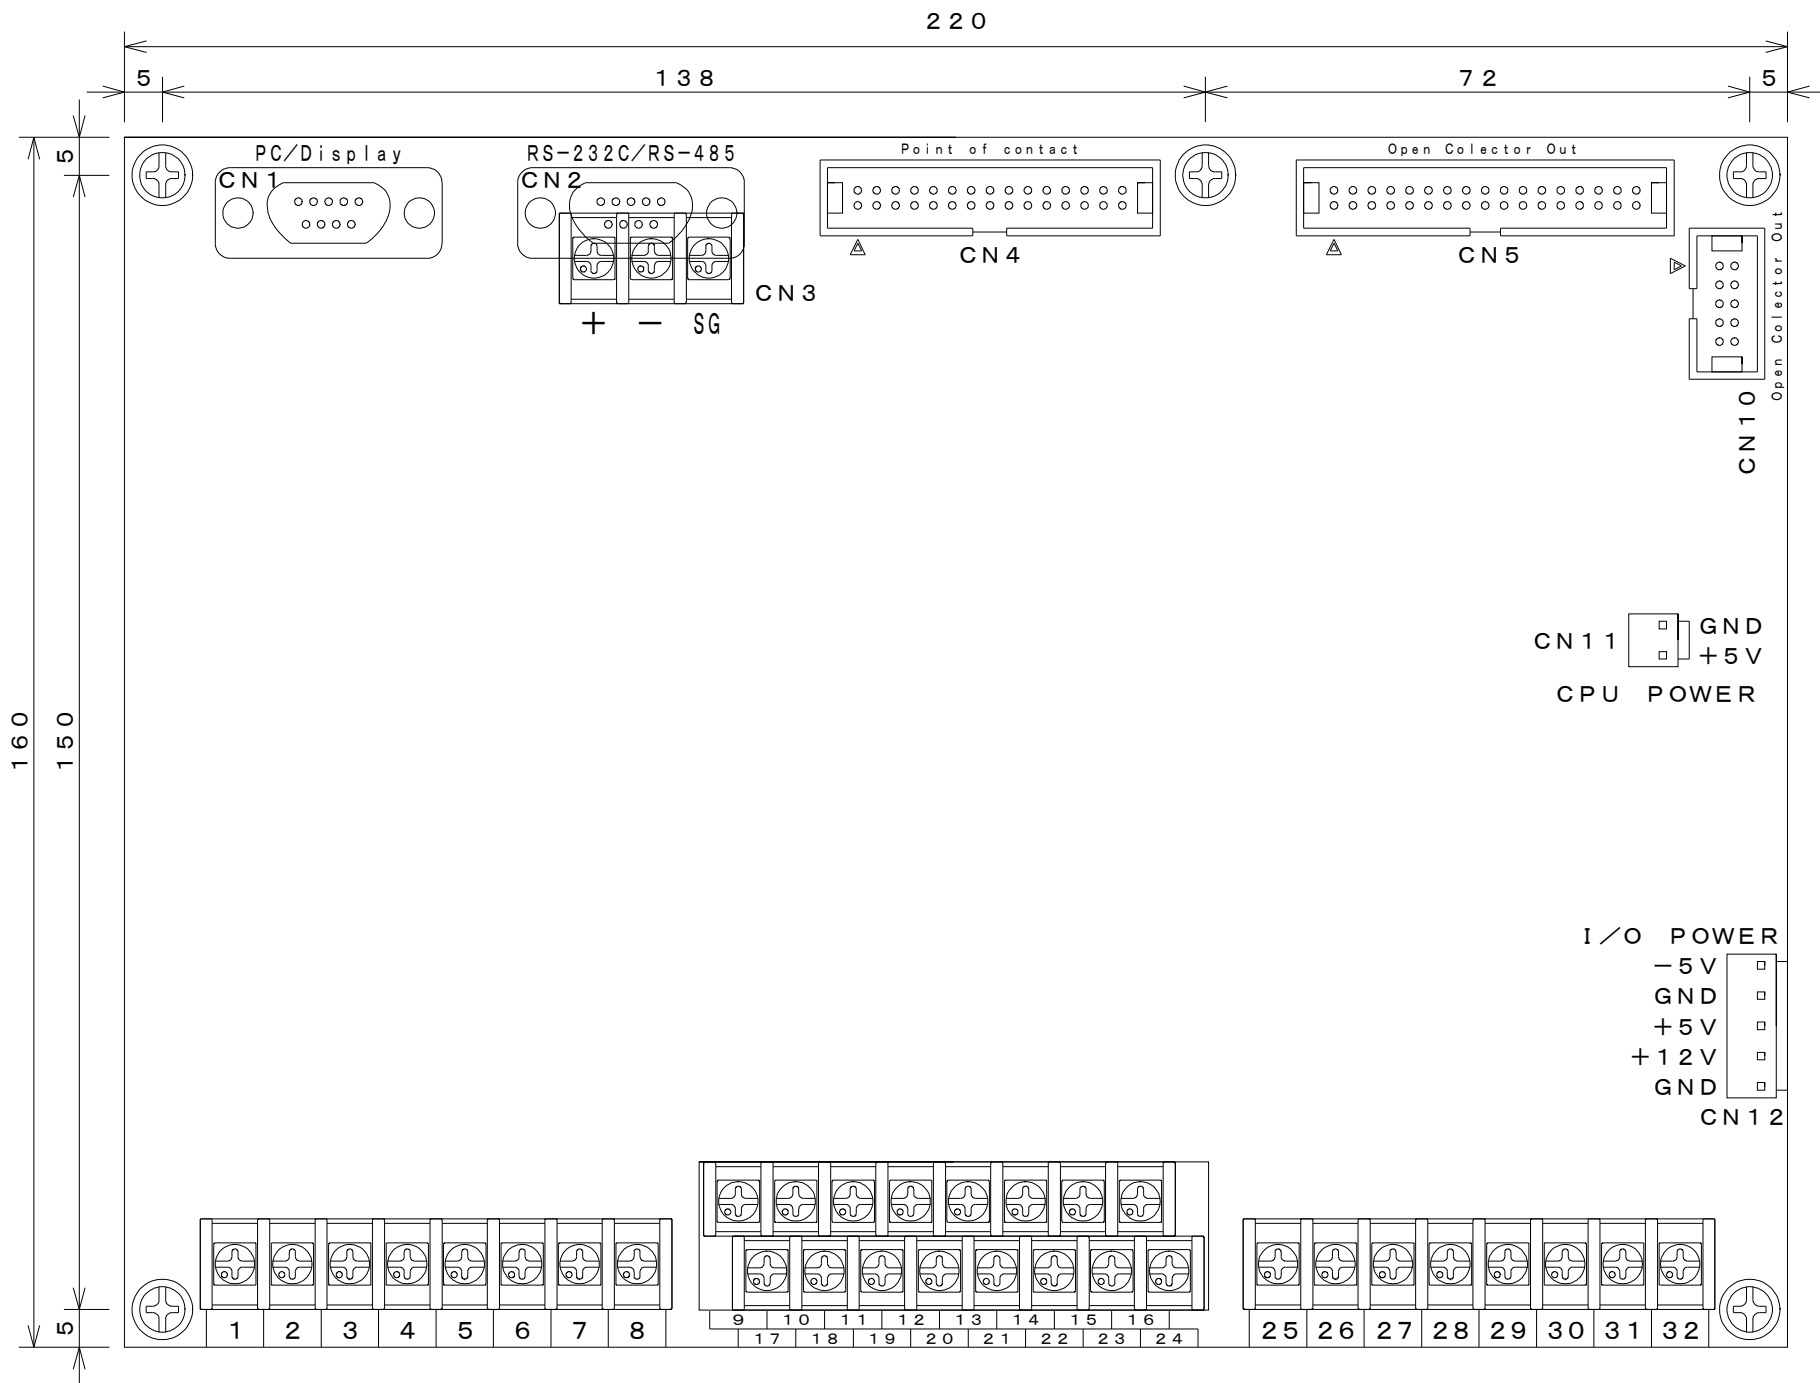

CN 4		名 称
1	COM	無電圧、接点入力×24点
2		
3		
4		
5		
6		
7	24	
8	23	
9	22	
10	21	
11	20	
12	19	
13	18	
14	17	
15	16	
16	15	
17	14	
18	13	
19	12	
20	11	
21	10	
22	9	
23	8	
24	7	
25	6	
26	5	
27	4	
28	3	
29	2	
30	1	

CN 5		名 称
1	COM	オープン・コレクタ出力 ×24点
2		
3		
4		
5		
6		
7	COM	オープン・コレクタ出力 ×24点
8		
9		
10		
11		
12		
13	24	
14	23	
15	22	
16	21	
17	20	
18	19	
19	18	
20	17	
21	16	
22	15	
23	14	
24	13	
25	12	
26	11	
27	10	
28	9	
29	8	
30	7	
31	6	
32	5	
33	4	
34	3	
35	2	
36	1	

CN 8		名 称
1	(+)	熱電対入力 (T)
2	(-)	-200~320℃
3	(+)	熱電対入力 (T)
4	(-)	-200~320℃
5	(+)	熱電対入力 (T)
6	(-)	-200~320℃
7	(+)	熱電対入力 (T)
8	(-)	-200~320℃

CN 6		名 称
9	(A)	Pt100 (DRY) 乾球 -200~250℃
10	(B)	
11	(b)	
12	(A)	Pt100 (AUX) 品温 -200~250℃
13	(B)	
14	(b)	
15	(+)	温度電流入力 4~20mA DC
16	(-)	

CN 6		名 称
17	(A)	Pt100 (WET) 湿球 -200~250℃
18	(B)	
19	(b)	
20	(A)	Pt100 -200~250℃
21	(B)	
22	(b)	
23	(+)	湿度電流入力 4~20mA DC
24	(-)	

CN 9		名 称
25	(+)	温度制御出力 4~20mA DC
26	(-)	
27	(+)	湿度制御出力 4~20mA DC
28	(-)	
29	(+)	温度伝送出力 -1~3.2V DC
30	(-)	
31	(+)	湿度伝送出力 0~1V DC
32	(-)	

CN 10		名 称
1	COM	オープン・コレクタ出力 (オプション) ×8点
2		
3	8	
4	7	
5	6	
6	5	
7	4	
8	3	
9	2	
10	1	

Pt100 / 熱電対 (T) どちらか選択